

Work Order ID 149415

Friday, July 22, 2016 3:09:07 PM

149415

AMOD

Page 1

Item ID: D3560-042

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Arm Weldment

Start Date: 9/15/2016 Start Qty: 3.00

~~*3*~~ 4 DAS
21
9-89

Cust Item ID:

Required Date: 9/22/2016 Req'd Qty: 3.00

Customer:

Reference:

Approvals: Process Plan: dm Date: 16/01/22 Tooling: _____ Date: _____Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3560	Rev D								

140

Weld per dwg A/R Aluminum rod Batch: 413562
Large Fab***140***

0.27

Large Fab

Large Fab

Memo

1-Weld assembly as per dwg D3560

STEP:

- 1- clean material (buff bracket and bottom of arm with blue pad)
- 2- set up bracket and arm on jig
- 3- preheat bracket and arm with torch
- 4- clean before welding with brush
- 5- set up machine to 135 amps
- 6- weld across bottom and top ends
- 7- reheat with torch (65 deg C)
- 8- on one side weld from bottom to top half way
- 9- same for other side (half way)
- 10- from half way point weld the rest of the first side (ease off pedal near end)
- 11- same for remaining side (ease off pedal near end)

4x

DAS
43
9-89

OCT 24 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 149415

Friday, July 22, 2016 3:09:07 PM

149415

Page 2

Item ID: D3560-042

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Arm Weldment

Start Date: 9/15/2016 Start Qty: 3.00

3

Cust Item ID:

Required Date: 9/22/2016 Req'd Qty: 3.00

3

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.01

Quality Control

(4)

16-10-26

DAS

9

9-89

160

QC9- Inspect visual per QSI004- Fusion Welds

0.00

160

QC

Memo

0.00

Quality Control

(4)

16-10-26

DAS

9

9-89

170

Chemical Conversion Coat per QSI005 4.1

0.00

170

HandFinish

Memo

0.05

Hand Finishing

(x4)

Ø

2016/10/27

BEB

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
				OTHER : ☐			

Work Order ID 149415

Friday, July 22, 2016 3:09:07 PM

149415

Page 4

Item ID: D3560-042 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Arm Weldment
Start Date: 9/15/2016 Start Qty: 3.00 ***3*** Cust Item ID:
Required Date: 9/22/2016 Req'd Qty: 3.00 ***3*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	Identify as per dwg & Stock Location: <u>WA003</u>	0.00				<u>4</u>	<u>SP</u>	<u>16-10-27</u>	
210									
Packaging	Memo	0.00							
Packaging	*** STOCK IN STEP CELL *** LOCATION: WA003								
220	QC21- Final Inspection - Work Order Release	0.00							
220									
QC	Memo	0.05							
Quality Control									

DAS 21 9-89 OCT 2 8 2016

DAS 21 9-89 OCT 2 8 2016

QA Closed: Date:

Work Order update only ☐

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. _____		Rework	☐	Skid-tube	☐	Cross tube	☐	Water Jet	☐	Engineering	☐
NCR No. _____		Scrap	☐	Machining	☐	Small Fab	☐	Prod. Eng. Coord.	☐	Quality	☐
		Use-as-is	☐	Thermoforming	☐	Finishing	☐	Rec/Store/Packaging	☐	Other	☐
		Suspected Unapproved	☐	Large Fab	☐	Composite	☐	Supplier	☐		☐
Date :		Step #:			QTY Effective :				MRB (QSI042) Approval		
Description Work Order Deviation					Disposition					Completed By	
										Lead hand / Supervisor Approval Verification	
										QC / QA Coordinator Approval	
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Root Cause Data ☐ 24 hr Feedback ☐					FAULT CATEGORY Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☐ Heat Treat ☐ Cut Too Short ☐ Mislabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence ☐						

Picklist Print

Friday, July 22, 2016 3:09:07 PM

Page 1

Work Order ID: 149415

149415

Parent Item: D3560-042

D3560-042

Parent Item Name: Arm Weldment

Start Date: 9/15/2016

Required Date: 9/22/2016

Start Qty: 3.00

Required Qty: 3.00

Comments: IPP Rev:A New Issue 07.05.24 EC
IPP rev B ECN 987 07.10.09 EC verified by: DD
IPP Rev:C ECN1048 07-12-18 DD verified by: EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2808

Manufactured

No

Each

26.0000

3

D2808

Spacer

**

Location

Loc Qty

Loc Code

GA

26

109348

6

146529

20

16/10/27
149435
DAS 36 9-89
(4x)

D3560-2

Manufactured

No

Each

4.0000

3

D3560-2

Arm

**

Location

Loc Qty

Loc Code

WA003

4

142496

4

B149437 → 4
DAS 43 OCT 24 2016
9-89

D3592-1

Manufactured

No

Each

28.0000

3

D3592-1

Plate

**

Location

Loc Qty

Loc Code

WA003

28

142862

3

146886

25

B149399 → 4
DAS 43 OCT 24 2016
9-89

DQA: _____ Date: _____








**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval 	
Description Work Order Deviation		Disposition			
				Completed By _____	
				Lead hand / Supervisor Approval Verification _____	
				QC / QA Coordinator Approval _____	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

RELEASED
07.12.16

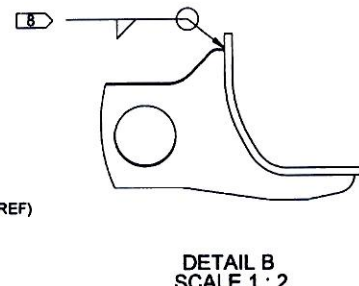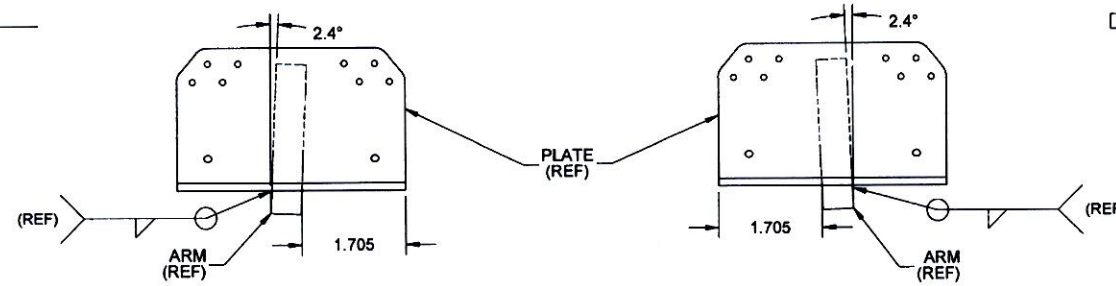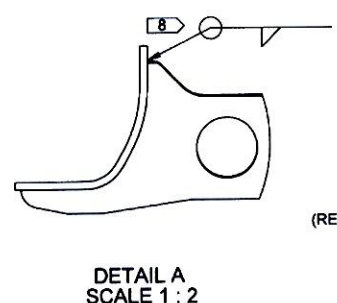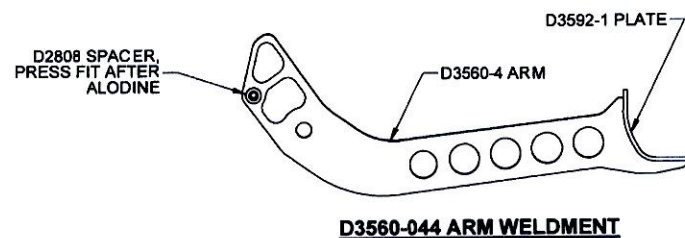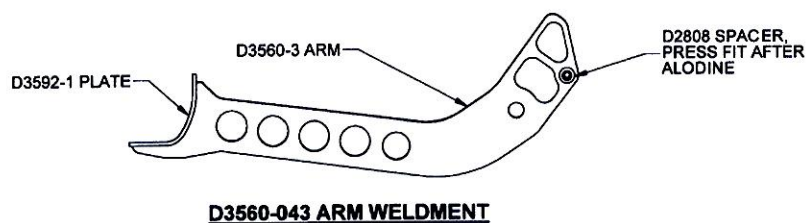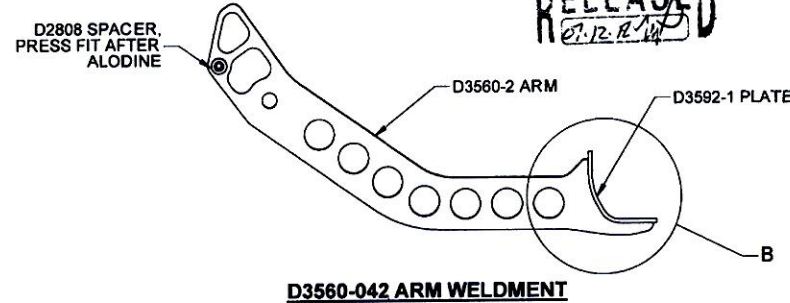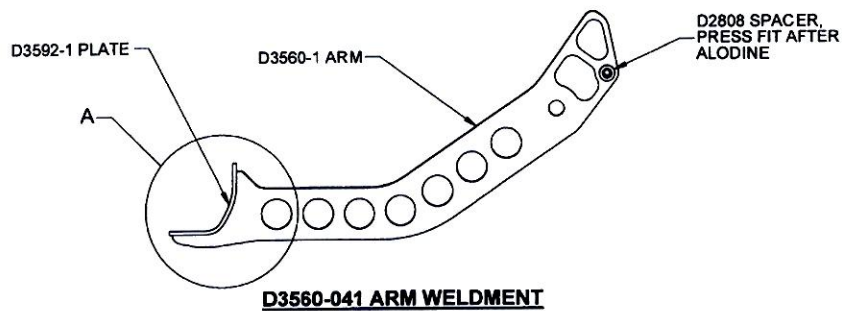


PARTS LIST


QTY -041	QTY -042	QTY -043	QTY -044	P/N	DESCRIPTION
X				D3560-041	ARM WELDMENT
	X			D3560-042	ARM WELDMENT
		X		D3560-043	ARM WELDMENT
			X	D3560-044	ARM WELDMENT
1	1	1	1	D2808	SPACER
1				D3560-1	ARM
	1			D3560-2	ARM
		1		D3560-3	ARM
			1	D3560-4	ARM
1	1	1	1	D3592-1	PLATE

- NOTES:**
- 1) MATERIAL: N/A
 - 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.015 MAX
 - 6) IDENTIFICATION: N/A
 - 7) WEIGHT: 1.23 lbs (TYP)
 - 8) WELDING: PER DART QSI 004


D	ADD D2808 PRESS FIT NOTE; REDRAWN IN SOLIDWORKS	DC	07.11.16
C	REMOVE POWDER COAT	CP	07.06.19
B	REDESIGN AS WELDMENT, ADD POCKETS	CP	07.01.15
A	NEW ISSUE	CP	06.09.25
REV.	DESCRIPTION	BY	DATE
DESIGN	197	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	LC		
CHECKED	5	DRAWING NO.	REV. D
MFG. APPR.	RP	D3560	SHEET 1 OF 5
APPROVED	RP	TITLE	SCALE
DE APPR.	RP	ARM WELDMENT	1:4
DATE	07.11.16	COPYRIGHT © 2008 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

w/o 149415 2m 16/07/22

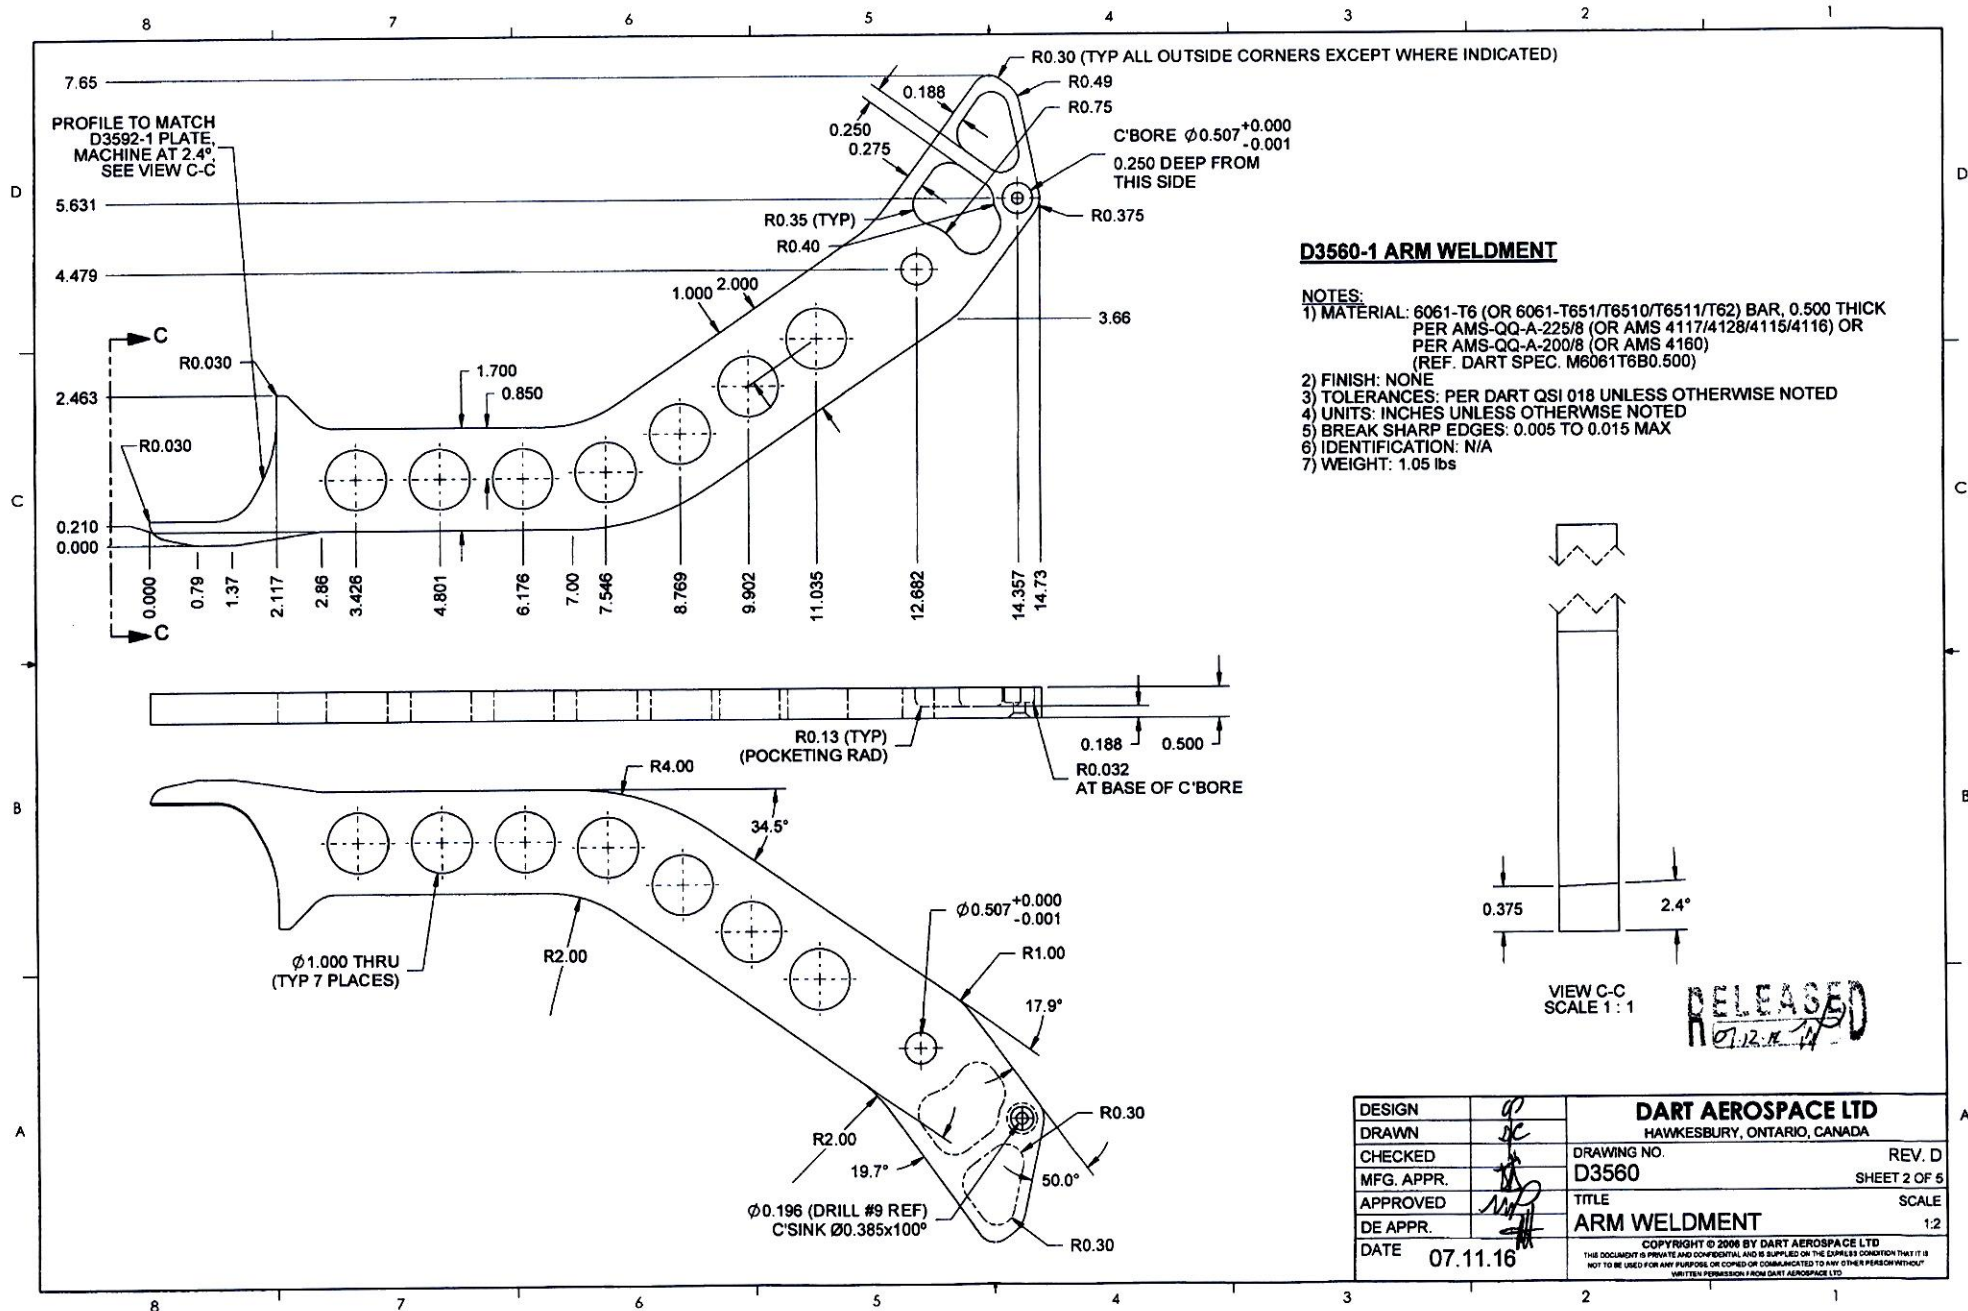

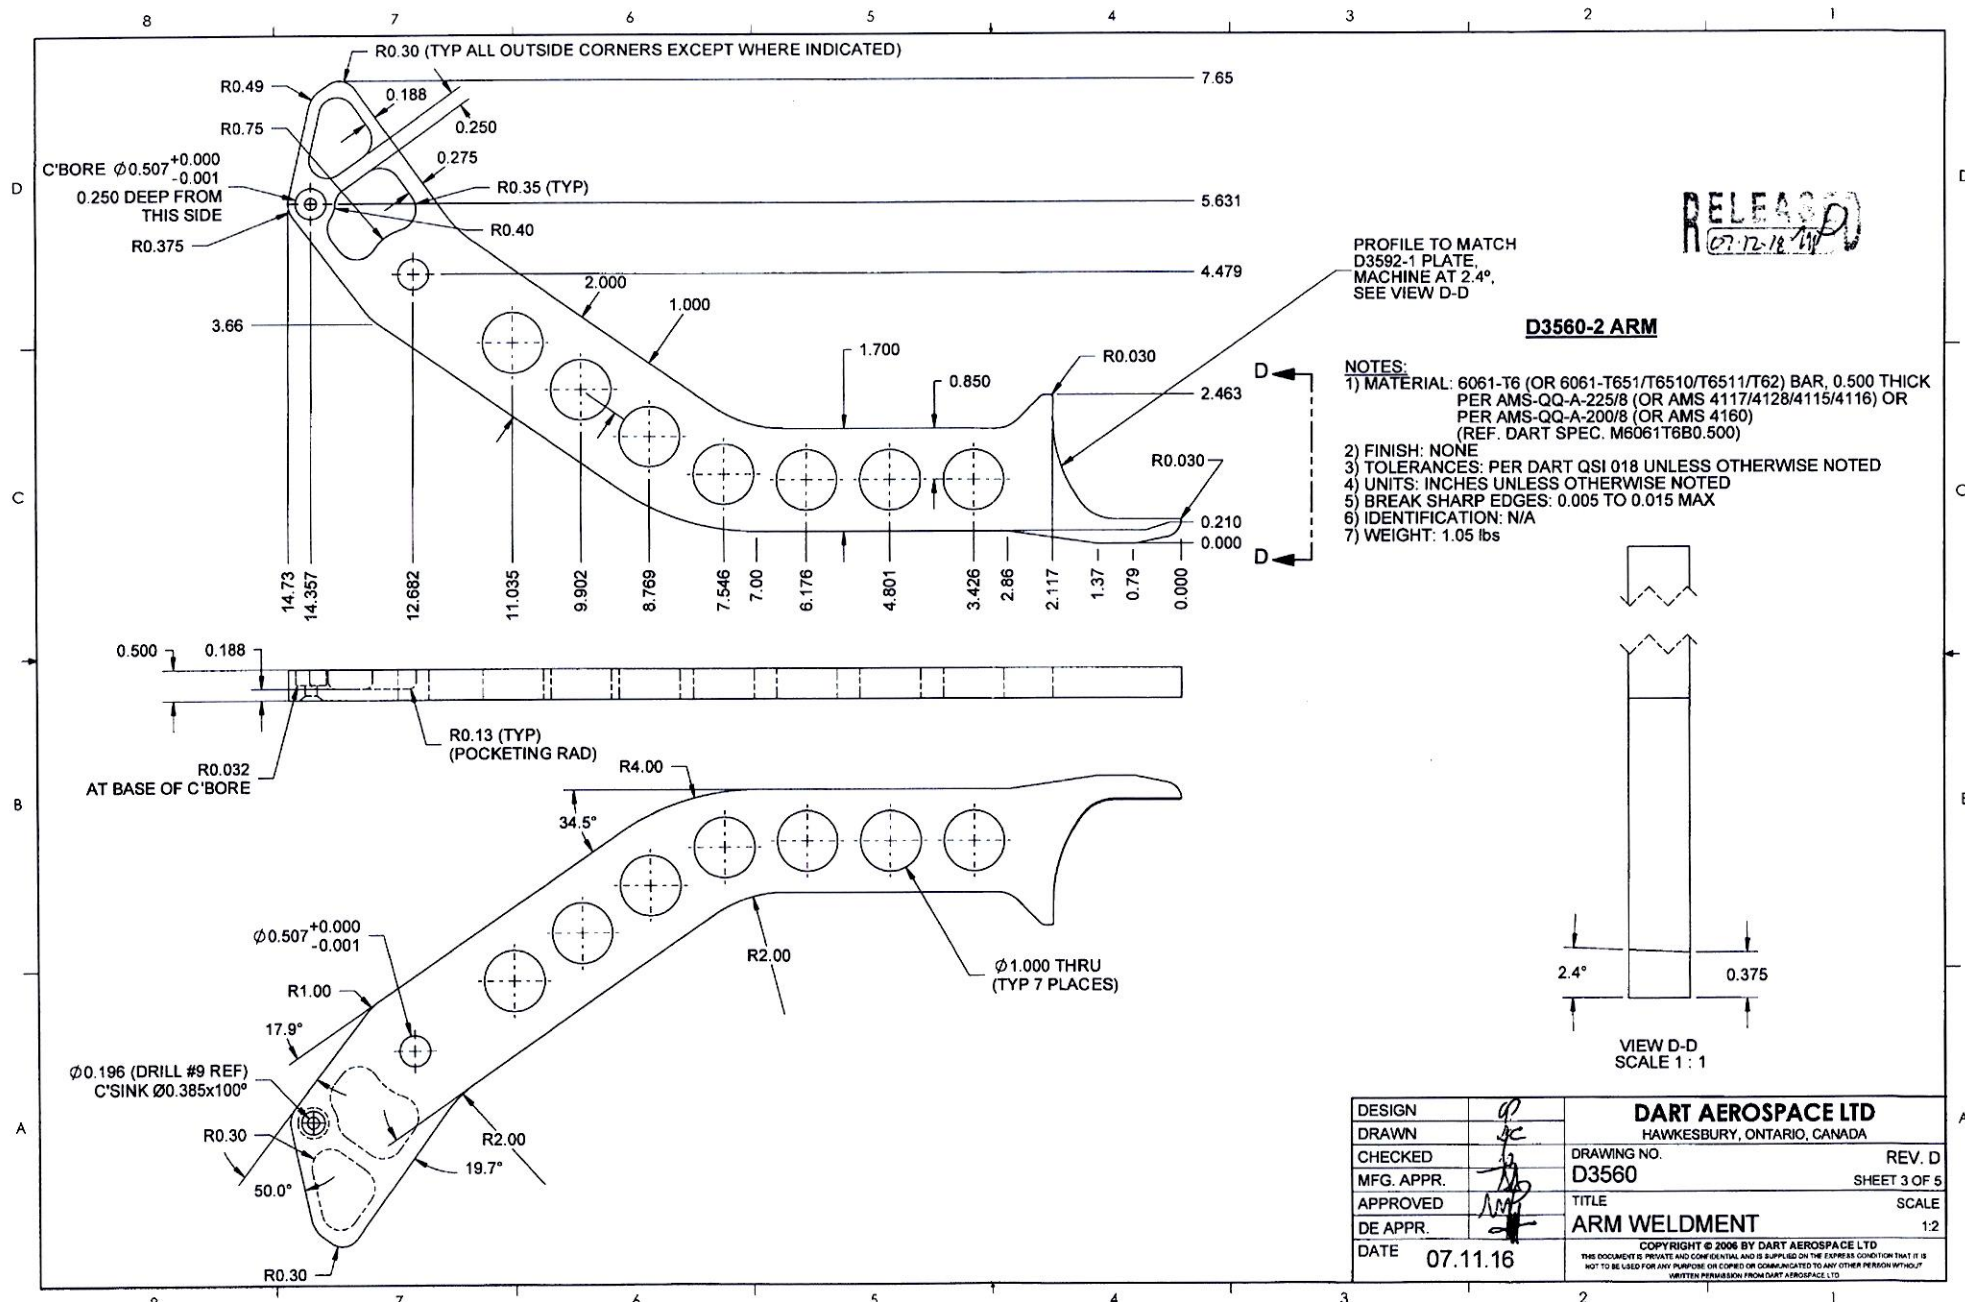




PROFILE TO MATCH
D3592-1 PLATE,
MACHINE AT 2.4°
SEE VIEW E-E

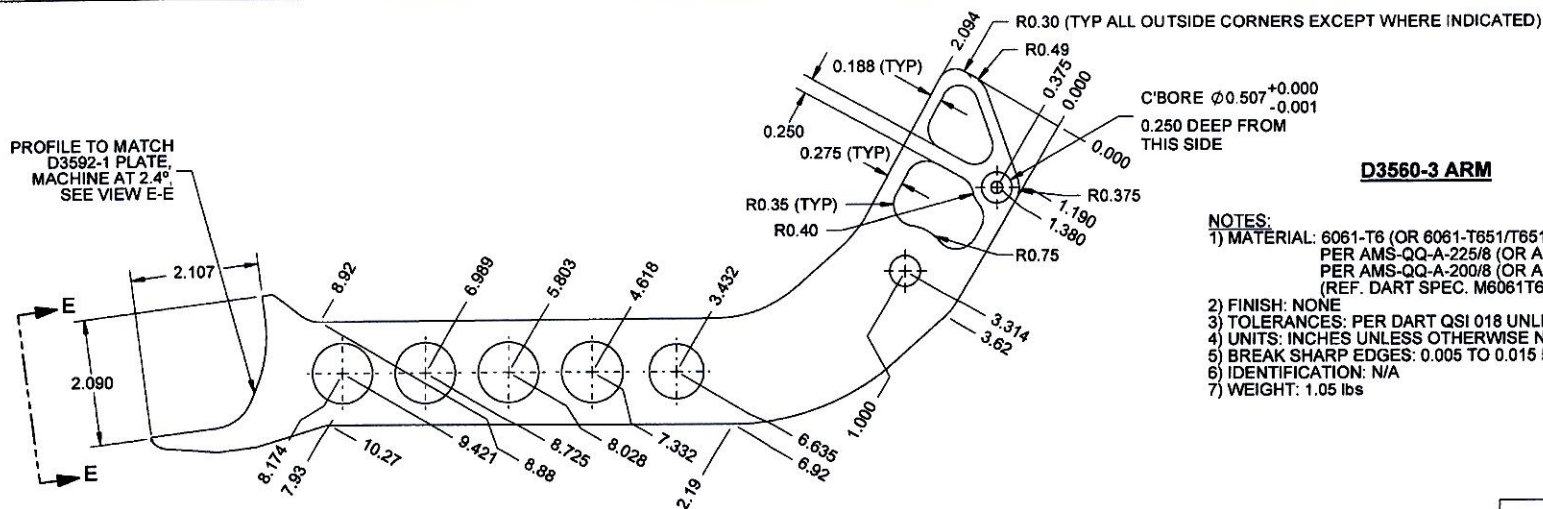

D3560-3 ARM

NOTES:

- 1) MATERIAL: 6061-T6 (OR 6061-T651/T6510/T6511/T62) BAR, 0.500 THICK
PER AMS-QQ-A-225/8 (OR AMS 4117/4128/4115/4116) OR
PER AMS-QQ-A-200/8 (OR AMS 4160)
(REF. DART SPEC. M6061T6B0.500)
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.015 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 1.05 lbs

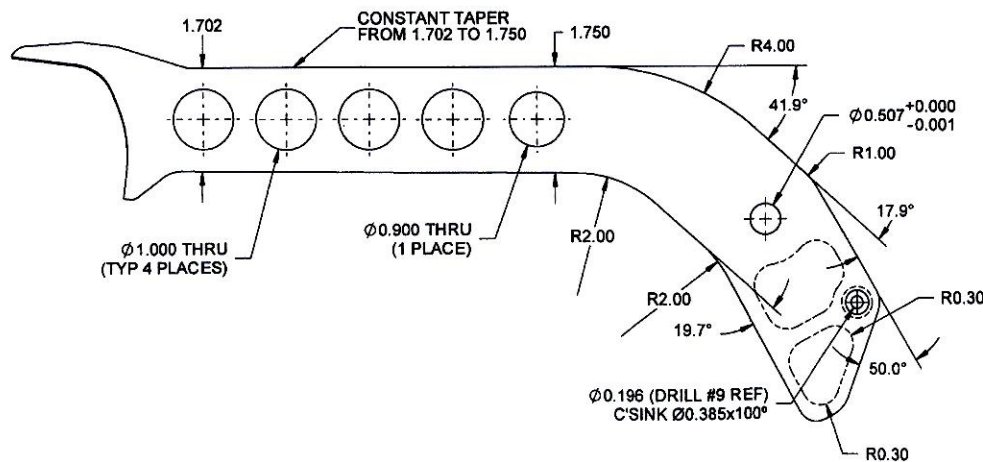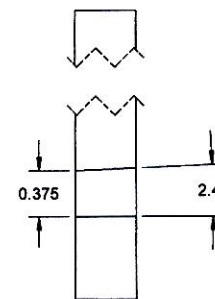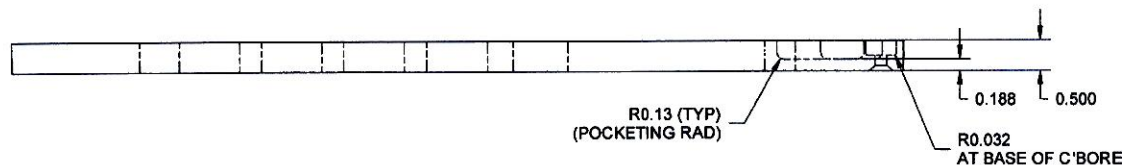

RELEASED
07-12-14

DESIGN	92	DART AEROSPACE LTD	
DRAWN	AC	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AC	DRAWING NO.	REV. D
MFG. APPR.	AC	D3560	SHEET 4 OF 5
APPROVED	AC	TITLE	SCALE
DE APPR.	AC	ARM WELDMENT	1:2
DATE	07.11.16	COPYRIGHT © 2006 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR LOANED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

